



FID_CANBUS_VT

Tractor's connector

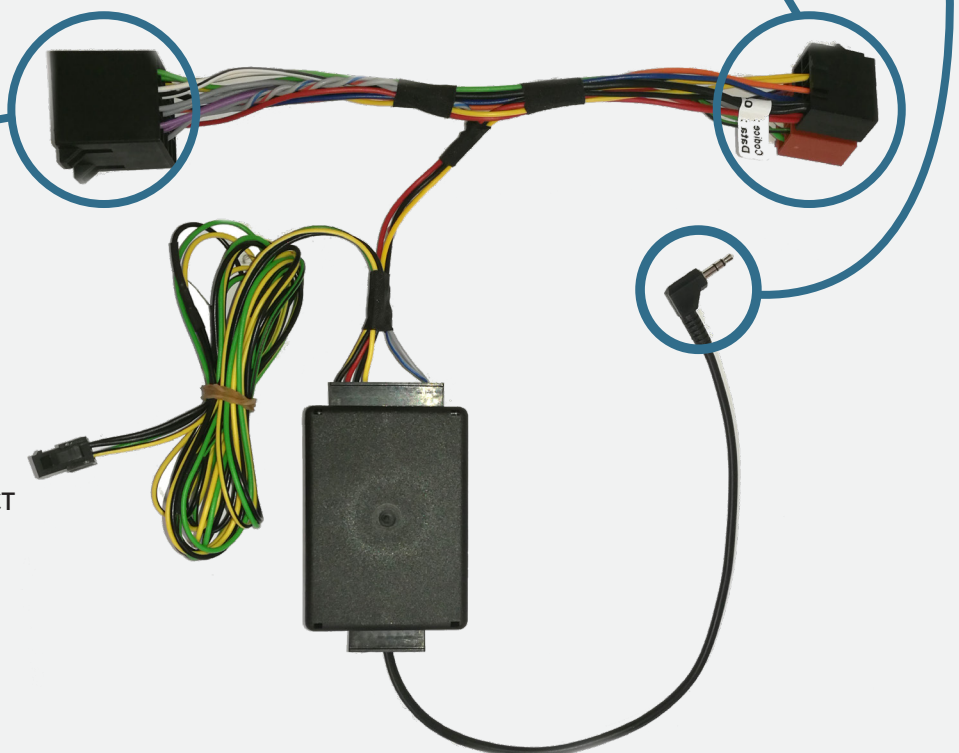

Back of the radio CT412_BT/CT412_DAB_BT

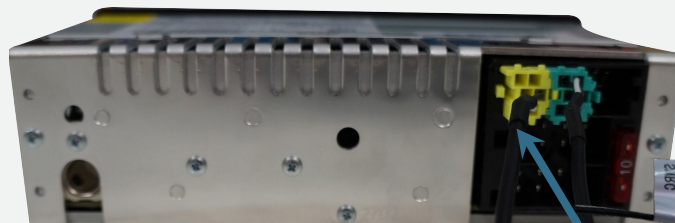

SmartTouch



AMS cannot be held responsible for the vehicle software update. The user is responsible for its product and commits to respect the listed precautions.